



Light quality control


GL SpectroSoft Flicker Report

Measurement name: 2022-08-23T16:14:39
Measurement time: 2022-08-23 16:14:39
Report time: 2022-08-23 16:17:39

Client name: Azzardo Ligthing
Model name: FARO BK
Item No: AZ3204
Serial No.:
Made by: John Smith

Flicker	99,76 Hz
Flicker index	0,006421
Flicker percent	6,10 %
SVM	0,0061
SAM	-6,38
Mp	0,069
VESA flicker	-58,37
JEITA flicker	-61,38
PstLM	0,144


Flicker chart

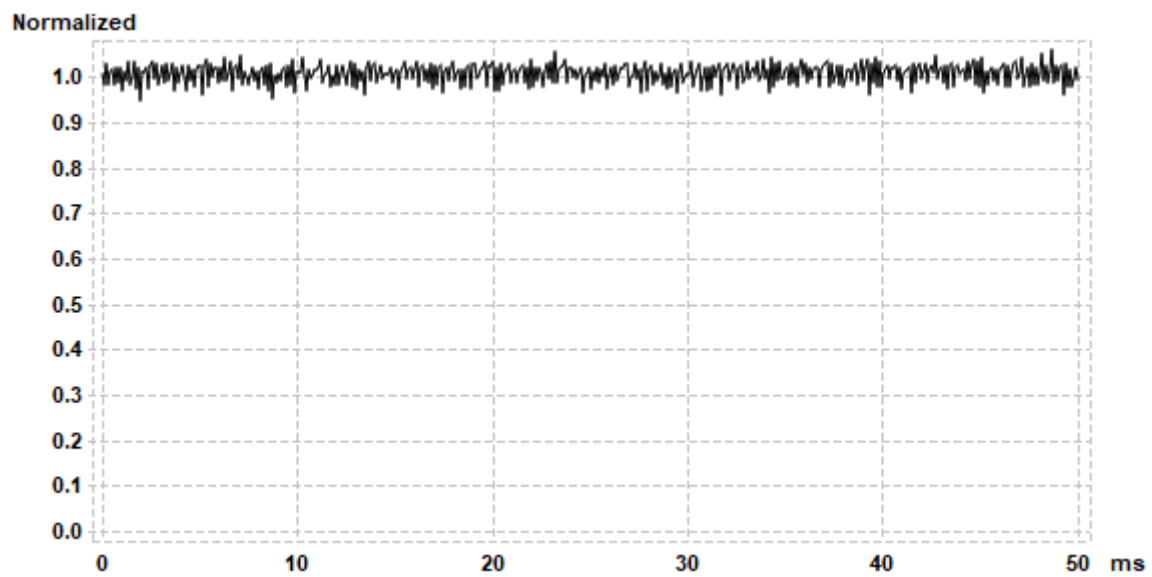

FFT chart



Light quality control

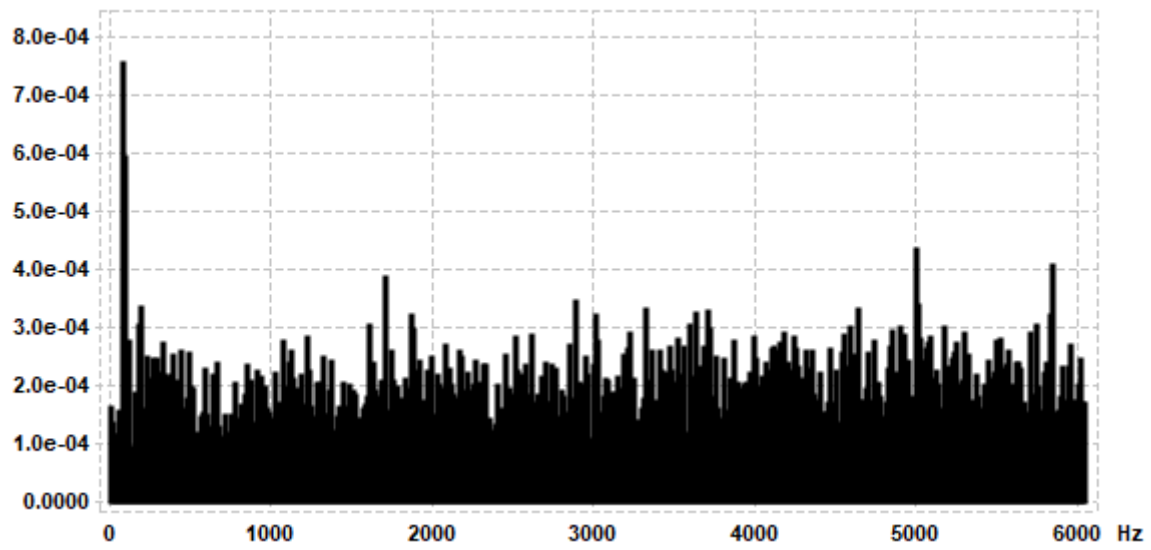




Light quality control


California's JA10 Test Method

Flicker percent 1000 Hz	1,159
Flicker percent 400 Hz	0,830
Flicker percent 200 Hz	0,622
Flicker percent 90 Hz	0,275
Flicker percent 40 Hz	0,188

FFT filtered 1000 Hz

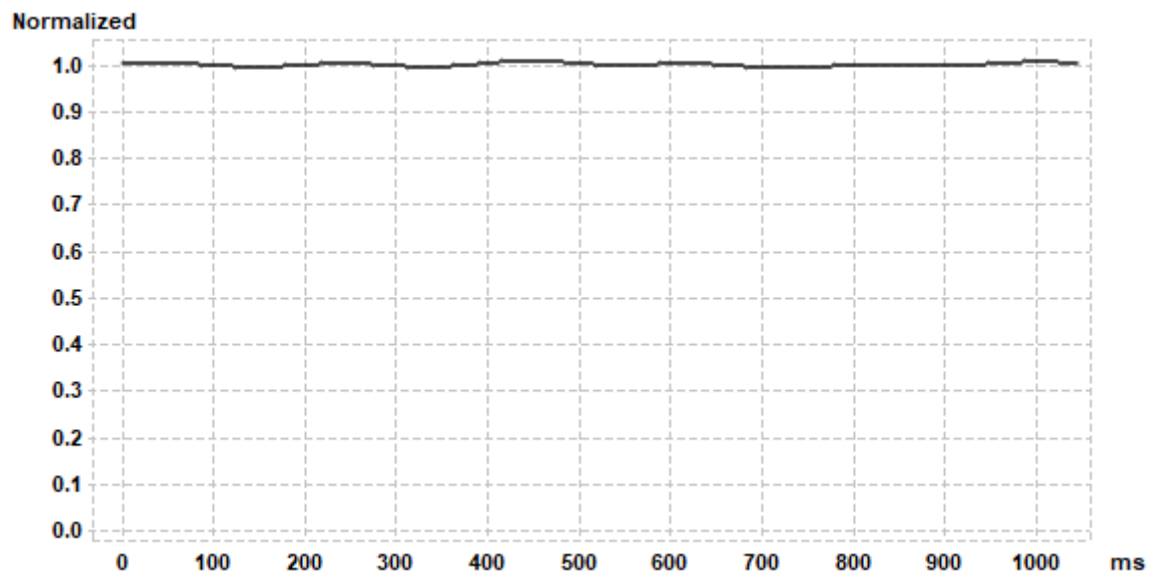


FFT filtered 400 Hz

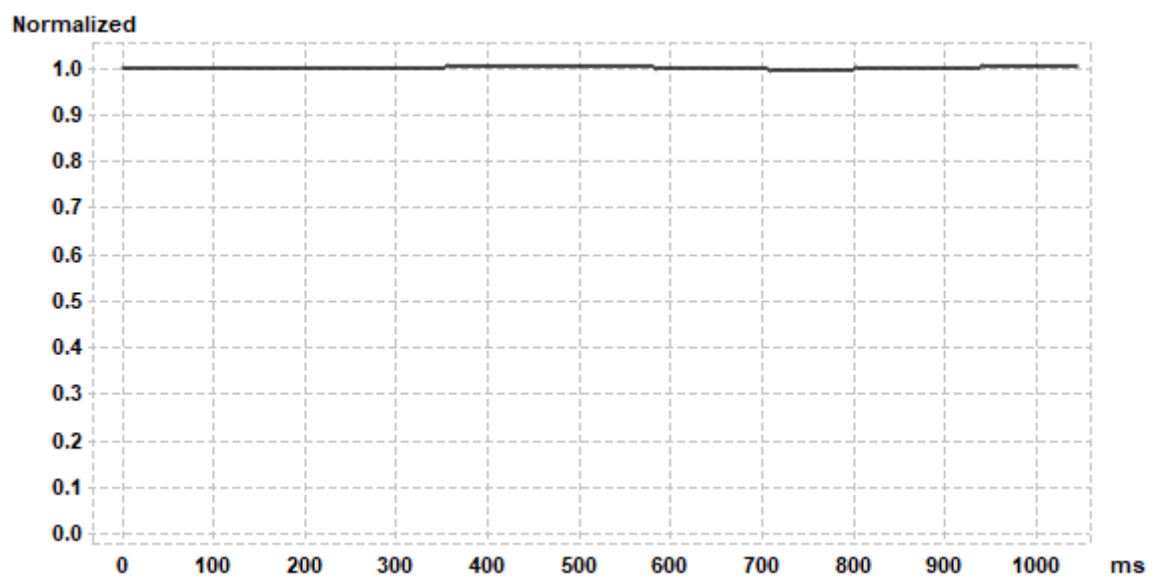




Light quality control

FFT filtered 200 Hz

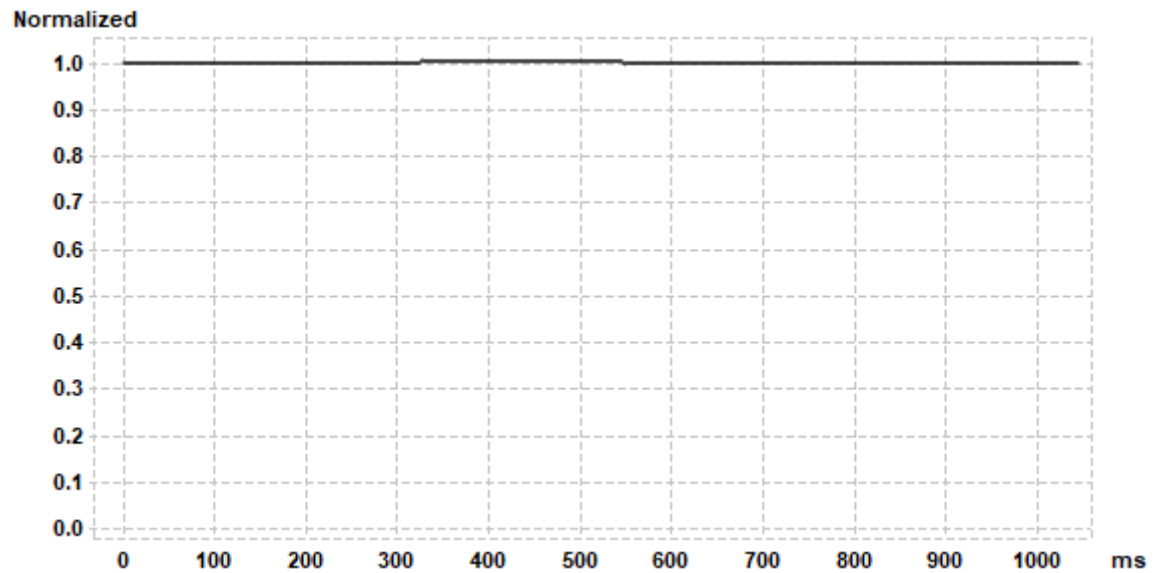

FFT filtered 90 Hz

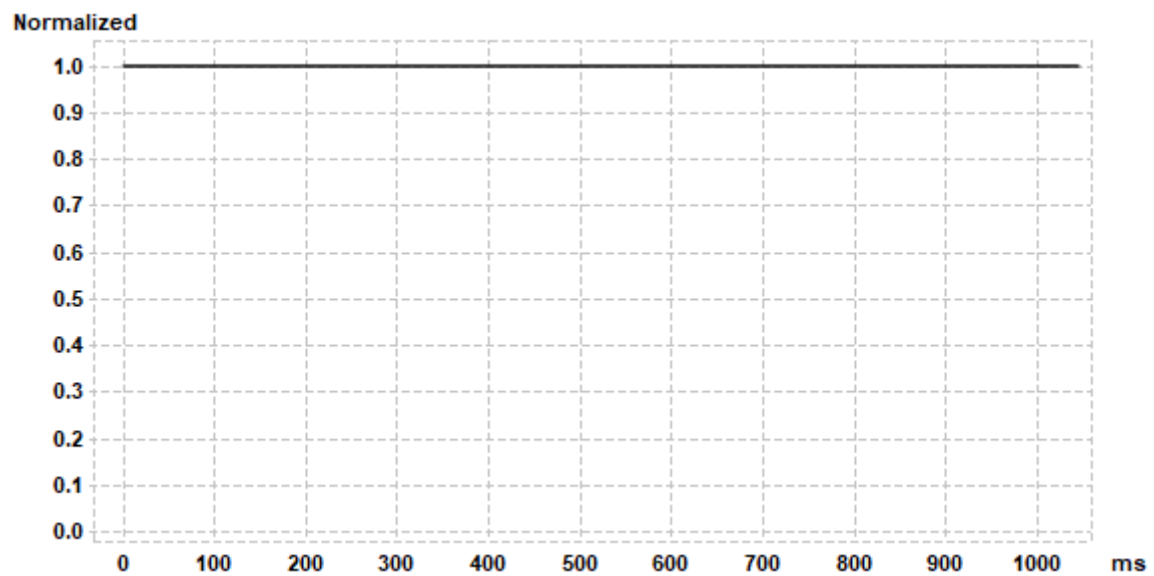

FFT filtered 40 Hz



Light quality control

